Maintaining Your PWR Piezo

Daily Care Tips for Your Device

Power Equipment


Ensure staying power and protect your investment by regularly maintaining your PWR Piezo Scaling device. Adhere to the following PWRful tips for **Best In Practice** performance.




After Each Patient

Maintenance Checklist

- ☐ Use Flush function with your PWR Piezo LED Handpiece attached using distilled water.
- ☐ Remove PWR Piezo Tip from PWR Piezo LED Handpiece using the Torque Wrench.
- ☐ Disconnect PWR Piezo LED Handpiece from cord.

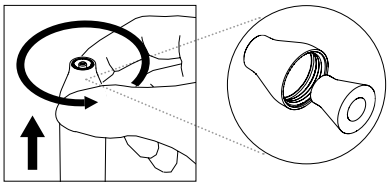

- ☐ Clean and Sterilize PWR Air Polishing and Piezo Handpieces, Torque Wrench and PWR Piezo Tip(s) used, all in individual sterilization pouches.

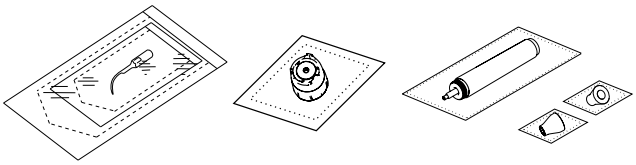


- ☐ Clean non-sterilizable parts of the device with a compatible EPA-registered intermediate-level surface disinfectant.

End of Day

Maintenance Checklist

- ☐ Use the Flush function with your PWR Piezo LED Handpiece attached using distilled water.
- ☐ Detach 500ml bottle and use the Flush function again to remove all remaining water.
- ☐ Ensure that your PWR Pair device is switched off.
- ☐ Clean the PWR Piezo device, handpiece cord and footswitch using a clean, dry cloth with a low fiber release, dampenend with a detergenet solution (pH 6-9).

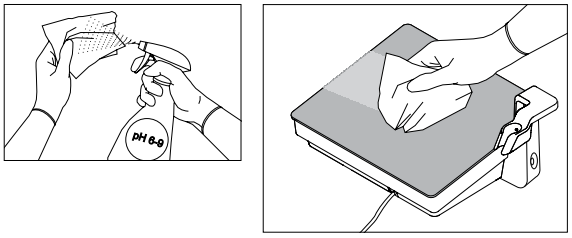

For a full list of instructions, please refer to the **PWR Piezo Instructions For Use**.

Hu-Friedy Mfg. Co., LLC, 1666 E. Touhy Ave., Des Plaines, IL 60018 | HuFriedyGroup.com

All company and product names are trademarks of Hu-Friedy Mfg. Co., LLC, its affiliates or related companies, unless otherwise noted. Marks not registered in all jurisdictions.

©2026 Hu-Friedy Mfg. Co., LLC. All rights reserved. HFL-961 / 2501

HuFriedyGroup The Best In Practice